

VIN	WDB2110701A123456	Model series/model designation	203.061
Order number		License plate	

Full list of fault codes and events

D000	Do not erase fault memory! Control unit Cellular telephone is defective.
D300	Component A34/15 (UHI portable CTEL holder (Universal Handy Interface)) is faulty or the cable between component A34/15 (UHI portable CTEL holder (Universal Handy Interface)) and component N123/1 (UPCI (Universal Portable Cell Phone Interface) control module) is faulty.
D400	This message does not immediately result in replacement of component. Component A34/15 (UHI portable CTEL holder (Universal Handy Interface)) is defective.
D401	This message does not immediately result in replacement of component. Communication fault between component A34/15 (UHI portable CTEL holder (Universal Handy Interface)) and Portable cellular telephone
D403	The microphone or speaker line at component A34/15 (UHI portable CTEL holder (Universal Handy Interface)) has a short or open circuit.
Event D001	This message does not immediately result in replacement of component. Watchdog error : The control unit has been reset due to an internal error.
Event D004	This message does not immediately result in replacement of component. The control unit was switched off due to excessive temperature (MOST transmitter and receiver unit)..
Event D011	This message does not immediately result in replacement of component. Voltage is too high.
Event D208	This message does not immediately result in replacement of component. No portable recognized
Event D402	This message does not immediately result in replacement of component. It was not possible to identify control unit A34/15 (UHI portable CTEL holder (Universal Handy Interface)).

Filename: F:\Programme\Das\trees\PKW\most\uhi2\menues\mnuhi2.s
Cell co-ordinate: 13 , 33