


MODEL 209 with CODE (581b) Convenience automatic air conditioning

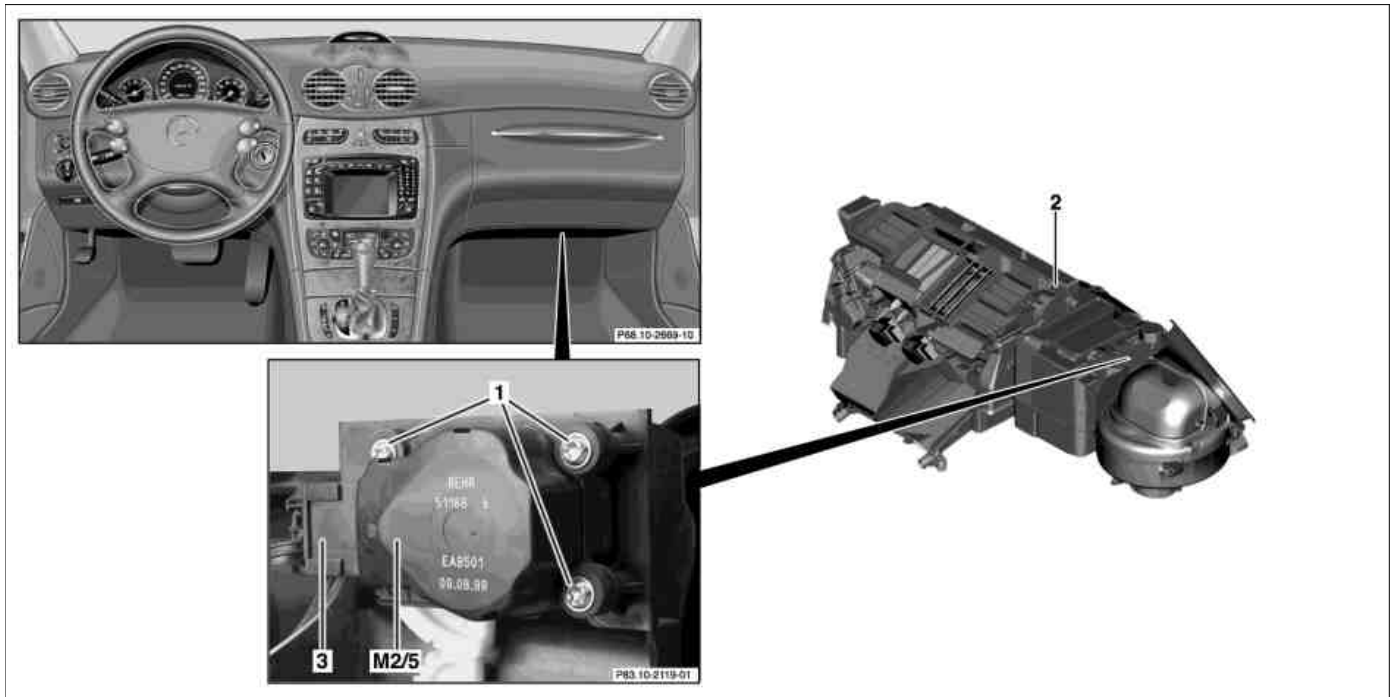

P83.10-2253-09

1 Bolts
2 AC housing

3 Electrical connector

M2/5 Fresh and recirculated air flap actuator motor

Modification notes

18.2.04	Disconnect/connect/remove ground lead from battery		
---------	--	--	--

	Remove/Install		
1	Remove instrument panel		AR68.10-P-1000Q
2	Remove bolts (1)		
3	Remove fresh and recirculated air flap actuator motor (M2/5)		
4	Separate electrical connection (3)		
5	Install in the reverse order		
6	Connect STAR DIAGNOSIS, normalize fresh and recirculated air flap actuator motor (M2/5), read out fault memory and delete Connect STAR DIAGNOSIS and read out fault memory	Diagnosis system STAR DIAGNOSIS	AD00.00-P-2000-04A *WH58.30-Z-1048-13A
7	Perform function check		

Commercially available tools

Number	Designation	
WH58.30-Z-1048-13A	STAR DIAGNOSIS diagnosis system, Compact Passenger Car	6511 1801 00