


MODEL 209 with CODE (581b) Convenience automatic air conditioning

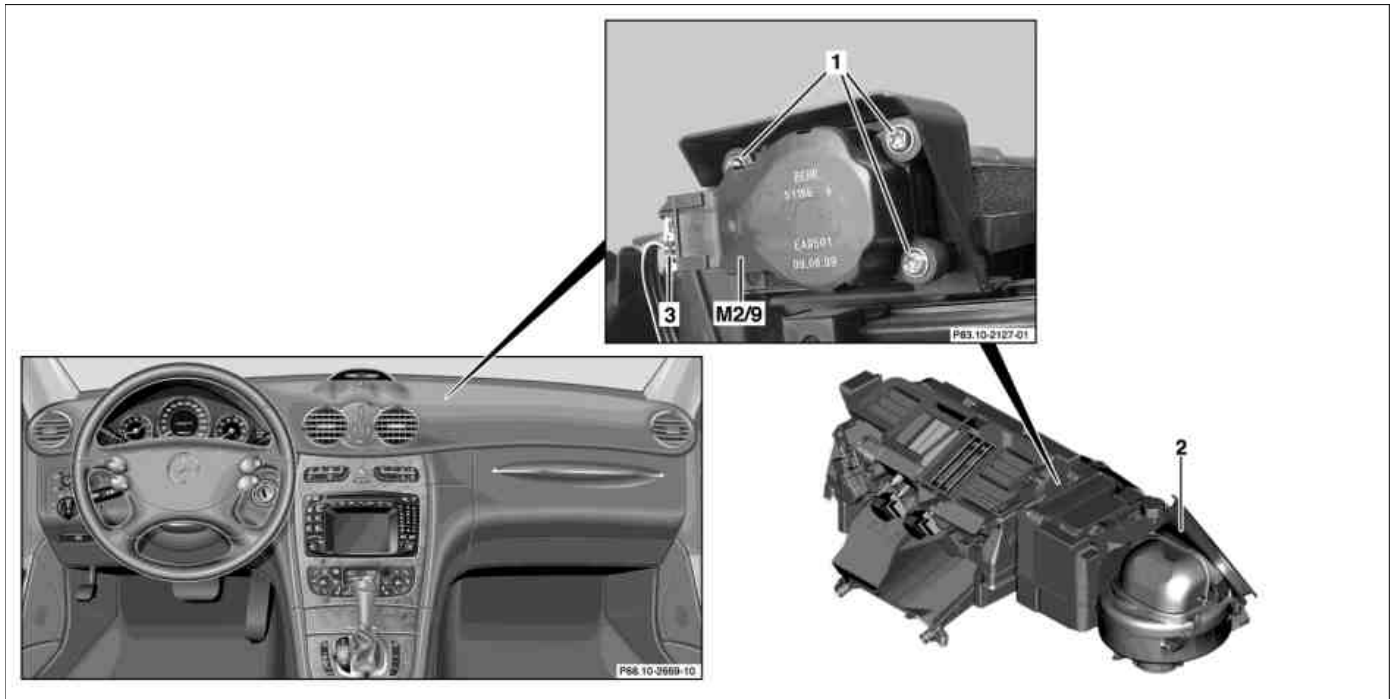

P83.10-2257-09

- 1 Bolts
- 2 AC housing

- 3 Electrical connector

- M2/9 Right defroster vent flap actuator motor

Modification notes

18.2.04	Disconnect/connect/remove ground lead from battery		
---------	--	--	--

Remove/Install		
1	Remove instrument panel	AR68.10-P-1000Q
2	Expose electrical wiring harness in area of right defroster vent flap actuator motor (M2/9)	
3	Remove bolts (1)	
4	Detach right defroster vent flap actuator motor (M2/9)	
5	Separate electrical connection (3)	
6	Install in the reverse order	
7	Connect STAR DIAGNOSIS, normalize right defroster vent flap actuator motor (M2/9), read out and erase fault memory Connect STAR DIAGNOSIS and read out fault memory	AD00.00-P-2000-04A *WH58.30-Z-1048-13A
8	Perform function check	Diagnosis system STAR DIAGNOSIS

Commercially available tools

Number	Designation	
WH58.30-Z-1048-13A	STAR DIAGNOSIS diagnosis system, Compact Passenger Car	6511 1801 00