


MODEL 209 except CODE (581b) Convenience automatic air conditioning

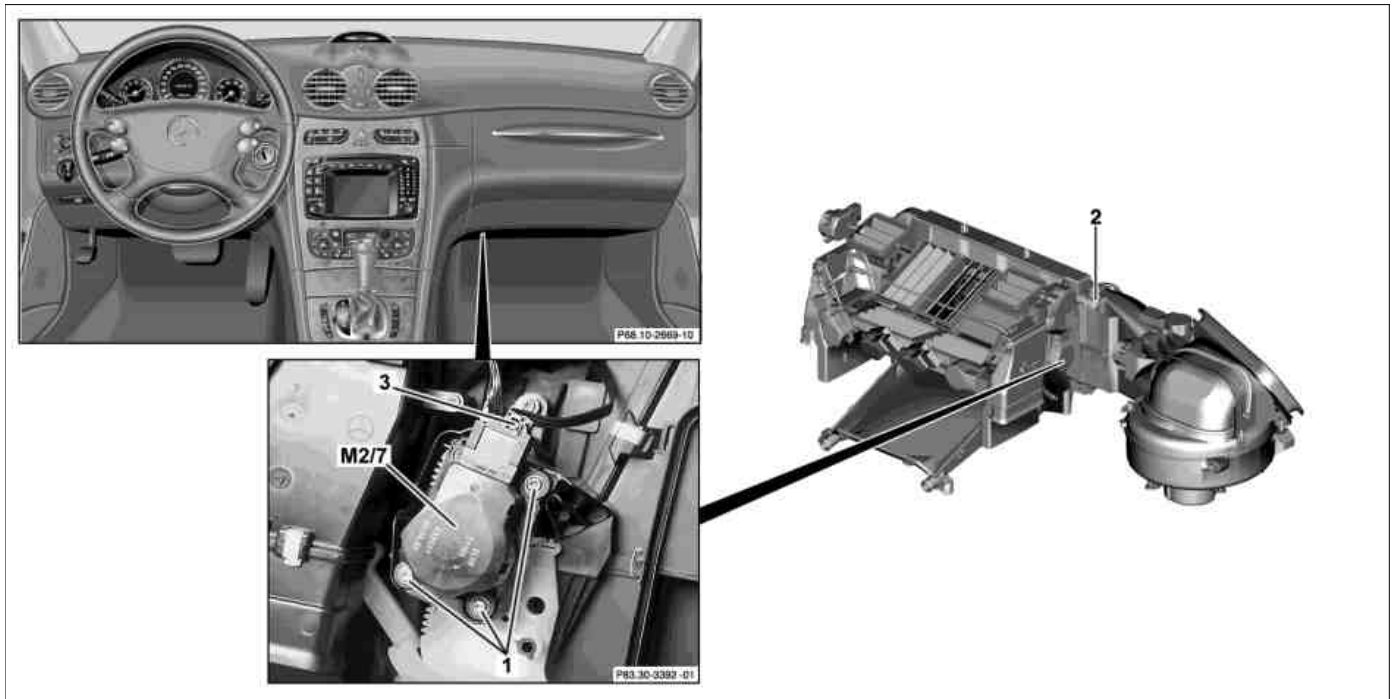

P83.10-2254-09

1 Bolts
2 AC housing

3 Electrical connector

M2/7 Right blended air flap positioning motor

Modification notes

18.2.04	Disconnect/connect/remove ground lead from battery		
---------	--	--	--

	Remove/Install		
1	Remove glove compartment		AR68.10-P-1400Q
2	Remove cover below instrument panel on passenger side		
3	Remove bolts (1)		
4	Detach right blending air flap actuator motor (M2/7)		
5	Separate electrical connection (3)		
6	Install in the reverse order		
7	Connect STAR DIAGNOSIS, normalize right blending air flap actuator (M2/7), read out and erase fault memory Connect STAR DIAGNOSIS and read out fault memory		AD00.00-P-2000-04A
		Diagnosis system STAR DIAGNOSIS	*WH58.30-Z-1048-13A
8	Perform function check		

Commercially available tools

Number	Designation	
WH58.30-Z-1048-13A	STAR DIAGNOSIS diagnosis system, Compact Passenger Car	6511 1801 00