
AR88.10-P-1300P

Remove/install fender liner in front fender

Shown on model 203


- Front fender liner 1
- 2 Center fender liner
- Rear fender liner 3

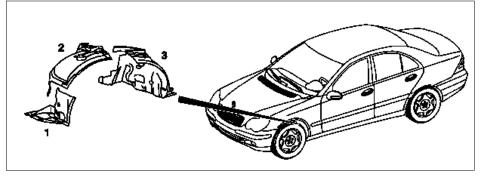


P88.10-2045-04

Shown on model 209 with code P98 Black Series

- Front fender liner 1
- 3 Rear fender liner
- 4 Expansion rivet
- 5 Bolt
- 6 7 Nut
- Clip

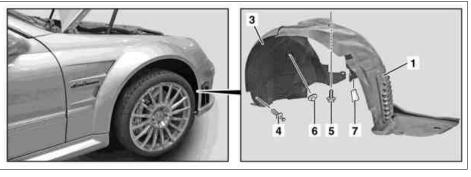

P88.10-2204-04

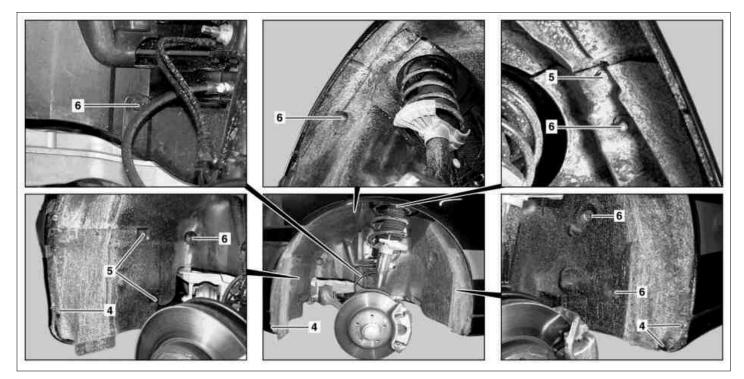

Shown on model 203

Expansion rivet 4

5 Bolt Nut

6

Remove/install			
	XX	Remove/install	

P88.10-2042-09

A Danger!	Risk of death caused by vehicle slipping or toppling off of the vehicle lift	Align vehicle between columns of vehicle lift and position four support plates at vehicle lift support points specified by vehicle manufacturer.	AS00.00-Z-0010-01A
1	Remove front wheel		
₩ AP	Remove/install wheels, rotate if necessary		AP40.10-P-4050Z
2	Remove clip (7)	Vehicles with code P98 Black Series	
3	Remove expansion rivet (4)		
4	Remove bolts (5)		
5	Remove nuts (6)		
6.1	Remove front, center and rear fender liners (1, 2, 3)	Vehicles without code P98 Black Series	
6.2	Remove front and rear fender liners (1, 3)	Vehicles with code P98 Black Series	
7	Install in the reverse order		