


Transmission 722.6 in MODEL 230

- 1 Door sill molding
 2 A-pillar paneling
 2a Cover
 2b Bolt
 3 Detent
 4 Electrical connector
 5 Electrical connector

N15/3 EGS control unit

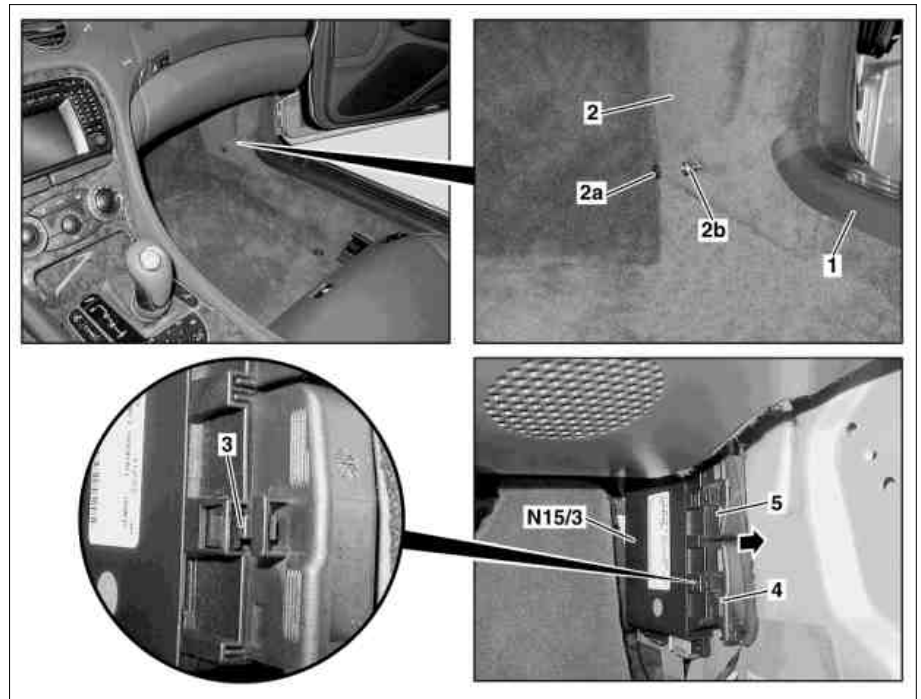

P27.19-2088-06

🔧 🔩	Remove/install		
ⓘ	Information on preventing damage to electronic components due to electrostatic discharge		AH54.00-P-0001-01A
1	Switch ignition off, remove ignition key (transmitter key).	<p>ⓘ On vehicles with code 889 Keyless Go: Press keyless go start/stop button repeatedly until the ignition is switched off. Remove the Keyless Go transmitter card or transmitter key from the vehicle and store beyond the reach of the transmitter (min. 2 m).</p>	
2	Detach door sill molding (1) upwards		
3	Remove A-pillar paneling (2)	<p>ⓘ Lever out cover (2a), unscrew bolt (2b).</p>	
4.1 🔧 AD	Carry out control unit adaptations using STAR DIAGNOSIS Connect STAR DIAGNOSIS and read out fault memory	<p>Only when replacing the ETC [EGS] control unit (N15/3).</p> <p>STAR DIAGNOSIS diagnosis system</p>	<p>AD00.00-P-2000-04A</p> <p>*WH58.30-Z-1048-13A</p>
5	Disconnect electrical connectors (4, 5) from ETC [EGS] control unit (N15/3)	<p>ⓘ Press notch (3) of connector locking mechanism.</p>	
6	Pull ETC [EGS] control unit (N15/3) out of bracket in direction of arrow		
7	Install in the reverse order		
8	Read out fault memory and erase if required	STAR DIAGNOSIS diagnosis system	*WH58.30-Z-1048-13A

Commercially available tools

Number	Designation
WH58.30-Z-1048-13A	STAR DIAGNOSIS diagnosis system, Compact Passenger Car 6511 1801 00