


P33.20-0279-09

|     | Remove/install  |  |  |
|-----|---|--|--|
|     | The damper must be installed to remove the upper transverse control arm               |  |  |
|     | <b>Installation</b>   | Replace self-locking nuts and bolts.   |  |
| 1   | Unscrew nut (6c)  | Nm   | *BA33.20-P-1002-01A  |
| 2   | Screw thrust piece (043a) onto the ball stud of the upper ball joint                  |  | *210589046300  |
| 3   | Press upper ball joint out of upper transverse control arm (6) using puller (043)     | <br>Clean conical joint.   | *124589033300  |
| 4   | Secure steering knuckle with a wire (arrow) on damper to prevent it from falling away | Do not stretch the brake hose and cables.  |  |
| 5.1 | Detach left upper transverse control arm from frame                                   | Tighten nut in ready-to-drive condition.<br>Nm   | *BA33.20-P-1007-01A  |
| 5.2 | Detach right upper transverse control arm from frame                                  | Tighten nut in ready-to-drive condition.<br>Model 208: With code 612b, xenon headlamp unit ↓<br>Remove front axle sensor of headlamp range adjustment<br>Model 202<br>Model 170: Remove air filter housing<br>Nm | AR82.10-P-4083B<br>AR33.20-P-0500-03A<br>*BA33.20-P-1007-01A |
| 6   | Check follower joint  |  | AR33.20-P-0425A  |
| 7   | Install in the reverse order  |  |  |

 **Wheel location, hub**


| Number | Designation | Model 170 | Model 202 | Model 208 |
|--------|-------------|-----------|-----------|-----------|
|        |             |           |           |           |

|                    |   |            |    |    |    |    |
|--------------------|---|------------|----|----|----|----|
| BA33.20-P-1002-01A | Self-locking nut, upper wishbone follower joint to steering knuckle | Initially  | Nm | 45 | 45 | 45 |
|                    |   | Inspection | Nm | -  | -  | -  |
| BA33.20-P-1007-01A | Self-locking nut of upper wishbone on front end                     |            | Nm | 65 | 65 | 65 |

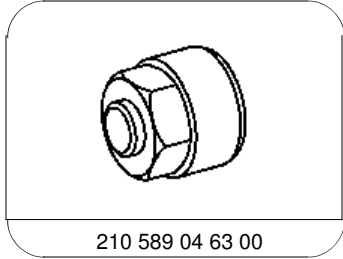

210 589 04 63 00

Thrust piece

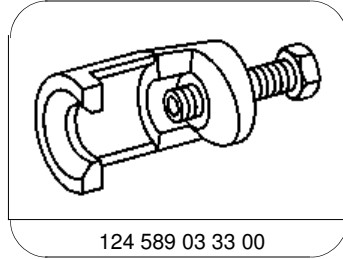

124 589 03 33 00

Puller