

MODEL 209


- 1 Glove box
- 2 Instrument panel lower section on passenger side
- 3 Right instrument panel cover
- 4 Center console
- 5 Footwell paneling



P68.10-3084-06

- 6 Socket
- 8 Bolts


E13/2 Glove box illumination with switch

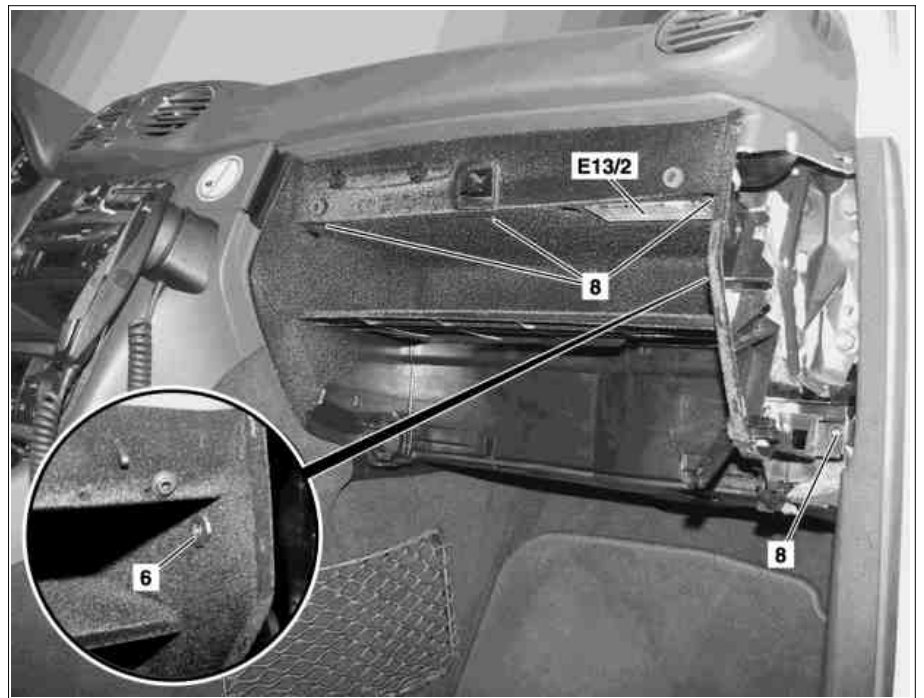

P68.10-3085-06

7 Antenna connection

X39/5 Handset transmitter and receiver connector

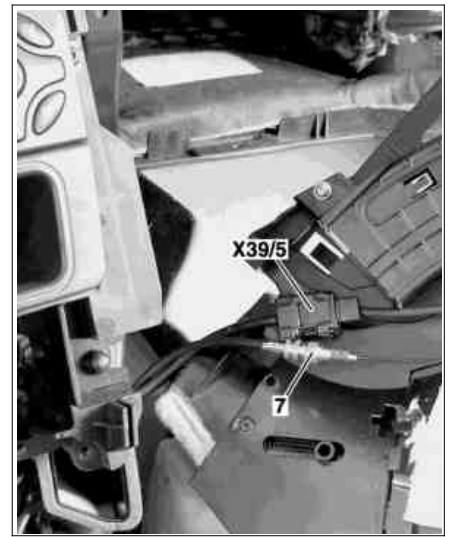


P82.70-4054-02

9 Bolts

10 Center console cover

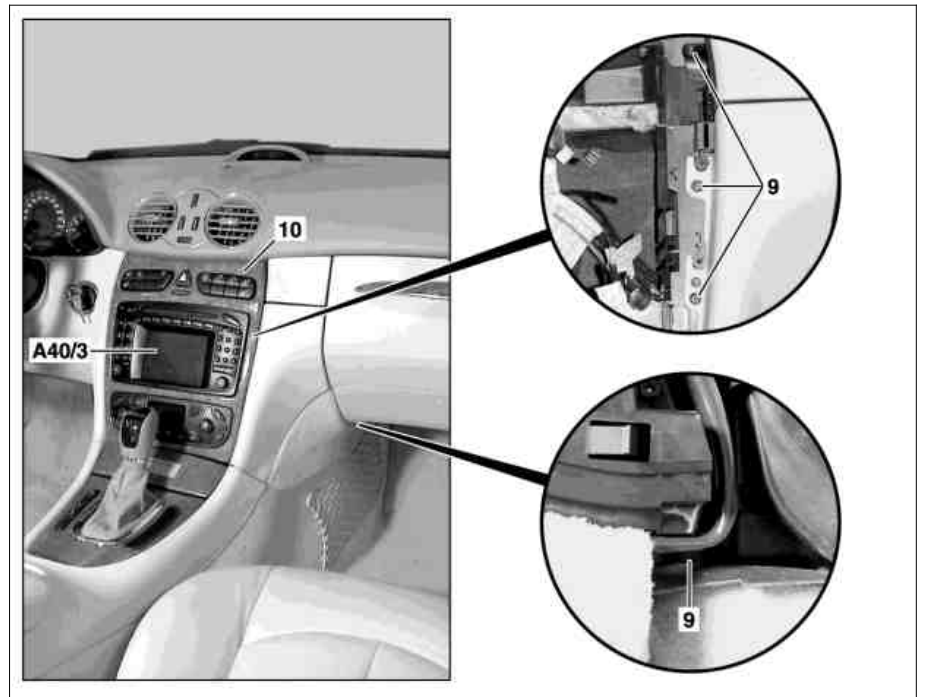


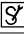
A40/3 COMAND operating, display and controller unit




P68.10-3086-06

**Modification notes**

29.5.06	"Disconnect/connect battery ground line" removed		
---------	--	--	--

 	Remove/install		
1	Remove cover below instrument panel		AR68.10-P-1520P
2	Open glove box compartment door		
3	Remove cover on right side of instrument panel (3)	<p> Do not break off front retaining tabs.</p> <p> Mounting wedge</p>	*110589035900
4	Press circlip of socket (6) toward inside		
5	Unclip socket (6) for glove compartment (1)		
6	Remove CD changer	With code 819 6-disk CD changer	AR82.64-P-7507P
7	Remove bolts (8)		
8	Remove center console cover (10)		AR68.20-P-2350Q
9	Remove center console (4)	Model 209 without code P98 Black Series Model 209 with code P98 Black Series	AR68.20-P-2000Q AR68.20-P-2000QBS
10.1	Loosen COMAND operating, display and controller unit (A40/3)	up to 31.5.04 with code 352 COMAND operating and display system, with code 498 Japanese version	AR82.85-P-7472Q

		as of 1.6.04 with code 498 Japanese version, with code 527 COMAND APS (with navigation), with code 530 COMAND APS USA (with navigation) <b>i</b> Position COMAND operating, display and controller unit (A40/3) so that bolts on instrument panel lower section on passenger side are accessible. <b>i</b> Do not unplug connectors.	AR82.85-P-7472QA
10.2	Loosen radio	up to 31.5.04 with code 756 Radio MB Audio 10 CD with VK/RDS as of 1.6.04 up to 31.5.04 with code 353 Audio 30 APS as of 1.6.04 with code 525 Radio MB Audio 50 APS <b>i</b> Position radio so that bolts on instrument panel lower section on passenger side (2) are accessible. <b>i</b> Do not unplug connectors.	AR82.60-P-7502Q  AR82.60-P-7502QA AR82.61-P-7412P AR82.61-P-7412QA
11	Remove bolts (9)		
12	Partially pull out instrument panel lower section on passenger side (2) with glove compartment (1)		
13	Detach coupling at glove compartment illumination with switch (E13/2)		
14.1	Disconnect connector for ATA glove compartment switch	With code 551 Anti-theft alarm system (ATA)	
14.2	Disconnect connector from glove compartment CL actuator	Model 209.4	
14.3	Detach handset transmitter and receiver connector (X39/5) and antenna connection (7)	With code 854 MB cell phone	
15	Remove instrument panel lower section (2) on passenger side with glove compartment (1).	<b>i</b> <b>Installation:</b> Ensure that paneling and footwell (5) is seated correctly.	
16	Install in the reverse order		

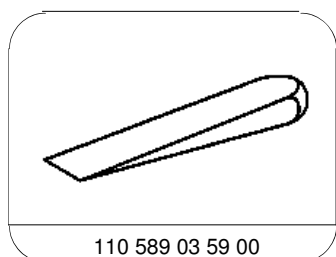

110 589 03 59 00

Mounting wedge