
MODEL 203

Shown on model 203.0

- 1 Lens
- 2 Release

N70 Overhead control panel control unit

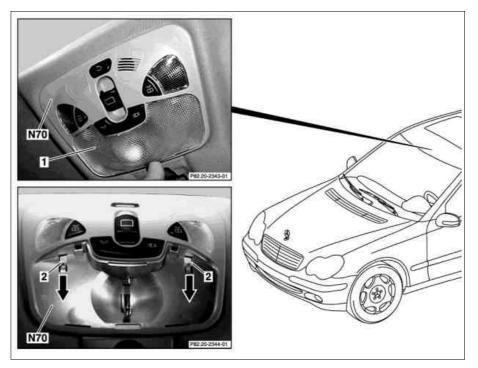


P82.20-2342-06

Modification notes

17.10.05 Disconnect ground line of battery, removed	Step 2	
---	--------	--

XX	Remove/install		
1.1	Transfer basic data from overhead control panel control unit (N70) to STAR DIAGNOSIS	When installing new overhead control panel control unit (N70). i Installation: Transfer buffered basic data to new overhead control panel control unit (N70), and for code (414) Tilting/sliding roof, normalize the anti-pinch protection.	
⊯ AD	Connect STAR DIAGNOSIS and read out fault memory	, ,	AD00.00-P-2000-04A
_		STAR DIAGNOSIS diagnosis system	*WH58.30-Z-1048-13A
2	Remove transmitter key from electronic ignition switch control unit		
3	Pry off lens (1) from overhead control panel control unit (N70)	Risk of cracks and fracture to headliner and overhead control panel control unit (N70). Mounting wedge	*110589035900
4	Press overhead control panel control unit (N70) releases (2)	Note direction of arrow	
5	Remove overhead control panel control unit (N70)	Installation: Excess pressure and tensile stress on the roof switch will damage the overhead control panel control unit (N70)	
6	Disconnect connectors from overhead control panel control unit (N70)		
7	Install in the reverse order		
8.1	Normalize tilting/sliding roof	i For vehicles with code (414) Tilting/ sliding roof	
9 ⊯AD	Read fault memory, erase if necessary Connect STAR DIAGNOSIS and read out fault memory		AD00.00-P-2000-04A
		STAR DIAGNOSIS diagnosis system	*WH58.30-Z-1048-13A

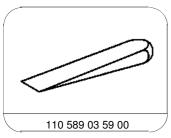

Mounting wedge

Commercially available tools

Number	Designation	
WH58.30-Z-1048-13A	STAR DIAGNOSIS diagnosis system, Compact Passenger Car	6511 1801 00